

# Embankment Failures on Soft Clay in Brazil

J.A. Ortigao

## Introduction

In the last 15 years a few well documented embankment failures have taken place at four different soft clay sites in Brazil (figure 1). The purpose of this note is to present a brief summary of this experience.

## Case histories

Case 1 - A full scale instrumented trial embankment was carried out at site 1 on Rio de Janeiro clay, in 1977 [6]. The ground consists of soft marine clay with liquid limit (*LL*) from 120% to 160%. The water content (*w*) ranges from 120 to 180%, the plastic limit (*PL*) from 60 to 80% and mean plasticity index (*PI*) of around 80%. The field vane (*FV*) shear strength  $s_u$  of the clay varies from 8 to 18 kPa, as shown in the profile in figure 2, the mean value being 10 kPa [5]. Table 1 summarizes these soil properties.

Figure 2 shows the geometry of the embankment just prior to failure. A stability analysis using uncorrected *FV* strength profile using Bishop's simplified method gave a factor of safety (*FS*) close to one, which closely matches the observed behaviour. Still, Bjerrum's [2] field vane correction factor for a clay showing  $IP=80\%$  is 1/1.6, which would result in a reduction of the strength to be used in analyses.

At the time of the trial, it was argued that the *FV* correction was not necessary. The reasons were: the high plasticity of the clay, marine origin, mineralogy and organic content of the clay. Additional experience was necessary to confirm this. Since then, additional case histories have been added to the Brazilian data base.

Case 2 - Another full scale instrumented embankment failure was carried out at site 2, about 150 km north of Rio de Janeiro, at the site of Juturnaiba Dam [3]. The soft ground has 7m of interlayered soft alluvial organic clay and peat, with *PI* between 40 to 80% for the clay layers. Mean *FV* strength value was 20 kPa, but data showed considerable scatter and its was difficult to select a design



Figure 1 Location of failures

Case Number	<i>PI</i> (%)	<i>FV</i> Strength $s_u$ (kPa)	Calculated Factor of Safety
1	80	8 to 18	0.95 - 0.99
2	40 to 80	10 to 35	0.96
3	50	5 to 12	1.0
4	40	10 to 25	0.98

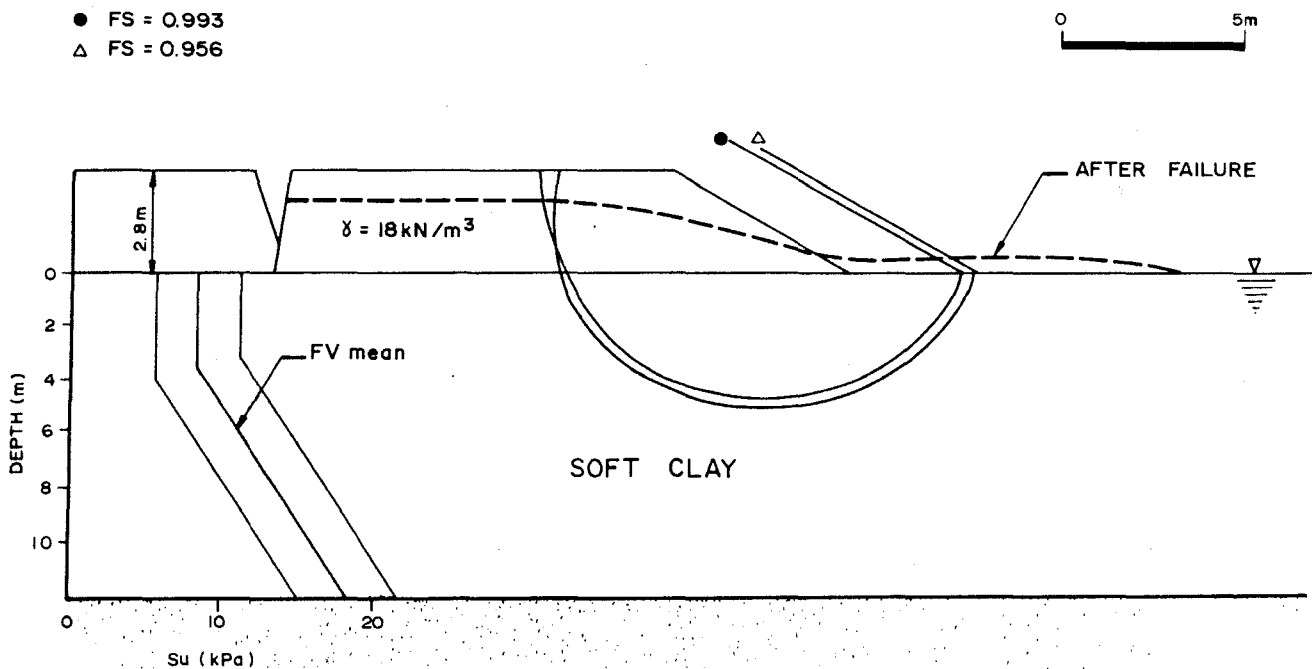


Figure 2 - Case 1 - Failure on Rio de Janeiro clay [6]

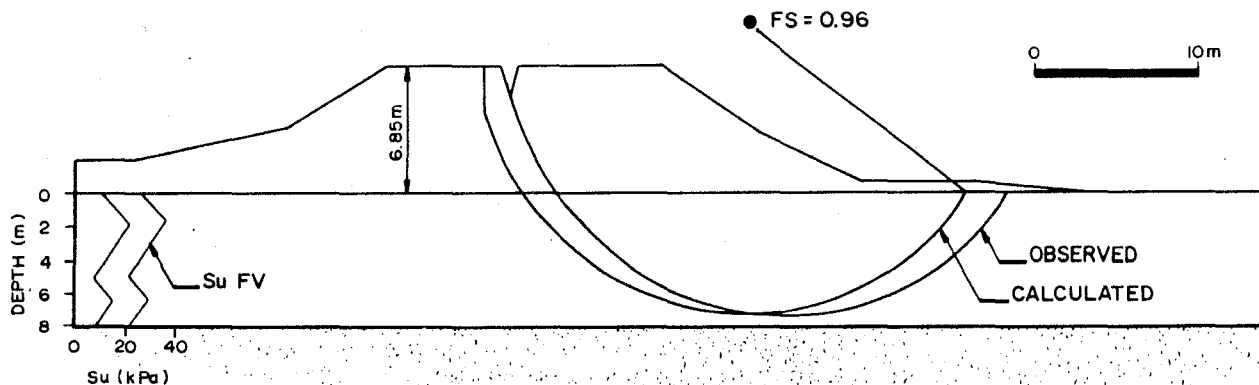


Figure 3 - Case 2 - Juturnaiba trial embankment [3]

s profile for the embankment dam.

Figure 3 shows the embankment cross section. The embankment failed when its height reached 6.85m. A total stress stability analysis employing the uncorrected mean strength profile and considering cracking in the embankment material (ie, reduced embankment strength) yielded a factor of safety of 0.96, closely matching the observed behaviour (table 1).

Case 3 - Unlike the previous trials, this case was an accidental failure. It took place on a railway embankment that crossed a 20km length of marshy area near the city of Sao Luis. The

embankment design was based on *FV* strength data obtained from 100m spaced boreholes along the proposed railway alignment. But, failure took place on a softer marine design stage (figure 4).

Again, the stability analysis based on detailed site investigation yielded  $PI=50\%$ ,  $LL=90\%$  and  $w=70$  to  $110\%$  and a factor of safety close to 1 for failure conditions and mean uncorrected *FV* profile (table 1).

Case 4 - An end-of-construction failure of a breakwater took place on a soft clay foundation at site 4 (figure 1). The foundation soils consisted of a 4m layer

of fine sand, followed by 8 m of soft clay with *FV* strength ranging from 10 to 20 tkPa. Figure 5 shows a cross section of the breakwater. Post-failure stability analysis used Janbu's simplified method, polynomial slip surfaces and detailed site investigation. Uncorrected *FV* strength data yielded  $FS=0.98$  (table 1).

**Final comments**

In the late 1970's it was surprising to find that *FV* corrections were not applicable to a high plastic clay, like the soft deposit of Rio de Janeiro clay. As more experience was obtained, it clearly

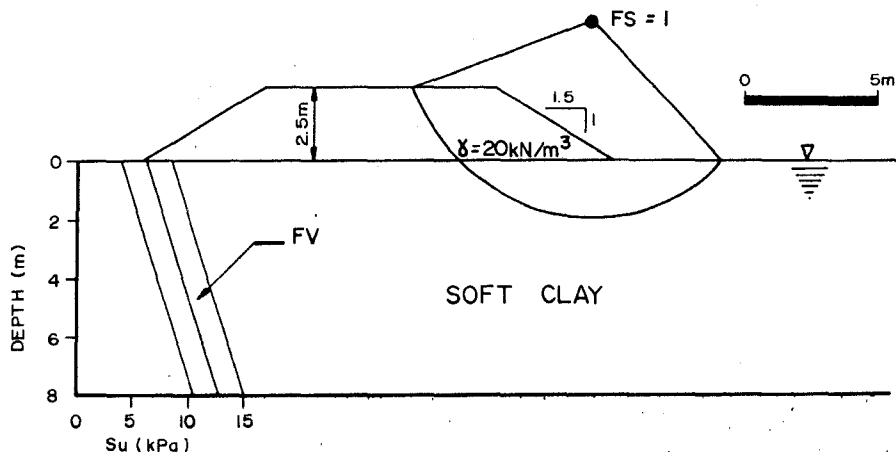


Figure 4 - Case 3 - Railway embankment failure near Sao Luis

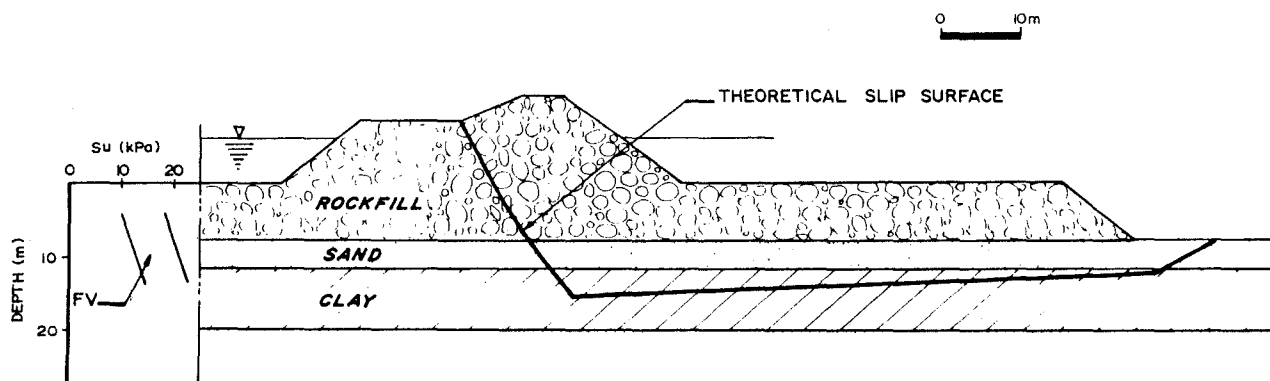


Figure 5 - Case 4 - Failure of a breakwater on soft soil

showed that site specific calibration data is very important.

Bjerrum's recommendations have recently been updated [1], but the new charts include considerable data scatter that makes the selection of a correction factor difficult.

When FV calibration data is not locally available, other forms of investigation, such as laboratory unconsolidated undrained triaxial tests, are recommended [4]. The results obtained should be compared with the FV strength. If there is a significant difference, corrections should be applied.

**References**

[1] Aas G., Lacasse S., Lunne T. & Hoeg

K. (1986) Use of in situ tests for foundation design. ASCE Specialty Conf. on In Situ Tests in Geotechnical Engineering, Blacksburg, Virginia Tech., Geotechnical Publication no. 6, pp 1-30.

[2] Bjerrum L. (1973) Embankments on soft ground, ASCE Specialty Conf. on Earth and Earth-supported Structures, Lafayette, Purdue University, vol. 2, pp 1-54.

[3] Coutinho R.Q. (1976) Medições da campo em um aterro experimental construído na área de barragem de Juturnaiba, DSc thesis, Federal University of Rio de Janeiro.

[4] Ortigao J.A.R. & Almeida M.S.S. (1988) Stability and deformation of

embankments on soft clay, Handbook of Civil Engineering Practice, Editors: P.N. Cheremisinoff, N.P. Cheremisinoff and S.L. Cheng, Technomic Publ., vol. 3, New Jersey, pp 267-336.

[5] Ortigao J.A.R. & Collet H.B. (1987) Errors due to soil-rod friction in field vane tests. ASTM Int. Symp. on Laboratory and Field Vane Shear Strength Testing, Tampa, ASTMSTP 1014, pp 104-116.

[6] Ortigao J.A.R. Werneck M.L.G. & Lacerda W.A. (1983) Embankment failure on clay near Rio de Janeiro, ASCE Journal of Geotechnical Engineering, vol. 107:2, pp 1460-1479.

# C O N T E N T S

<b>ASFE</b>	Preliminary Site Assessments: A Growing Liability Concern	20
<hr/>		
<b>COMPUTER APPLICATIONS</b>	Computing in Geotechnical Engineering. Past, Present and Future <i>Stephen G. Wright</i>	45
	Artificial Intelligence and Geotechnical Engineering Design Software <i>Charles H. Trautmann and Fred H. Kulhawy</i>	48
	Computers in Lab and Field Data Applications <i>W. Allen Marr</i>	50
	Software for Geotechnical Engineering Applications <i>John T. Christian</i>	53
	Siting, EIR/EIS and GIS <i>Apollo Teng</i>	55
	CAE for Geo/Environmental Engineers <i>Gregory B. Baecher, Laura A. McGrath, Lisa Boulais</i>	57
	Computer Applications in Geotechnical Engineering: In a High Performance Computing Environment <i>Reed L. Mosher</i>	60
<hr/>		
<b>GEOSPEC</b>	Dynamic and Static Testing of Nine Drilled Shafts at Texas A&M University Geotechnical Research Sites <i>Jean-Louis Briaud</i>	65
	Embankment Failures on Soft Clay in Brazil <i>J.A. Ortigao</i>	68
	Geotechnical Engineering at the Waterways Experiment Station <i>Timothy D. Stark</i>	71
<hr/>		
<b>DEPARTMENTS</b>	CGS News	3
	USNS News	13
	World News	18
	ASFE	20
	US Geotechnical Board	24
	Waste Geotechnics	28
	Geosynthetics	34
	Computer Applications	45
	Geospec	65
	Video Review	74
	Book Review	75
	Coming Events	76
	Call for Papers	78
	Marketplace	78

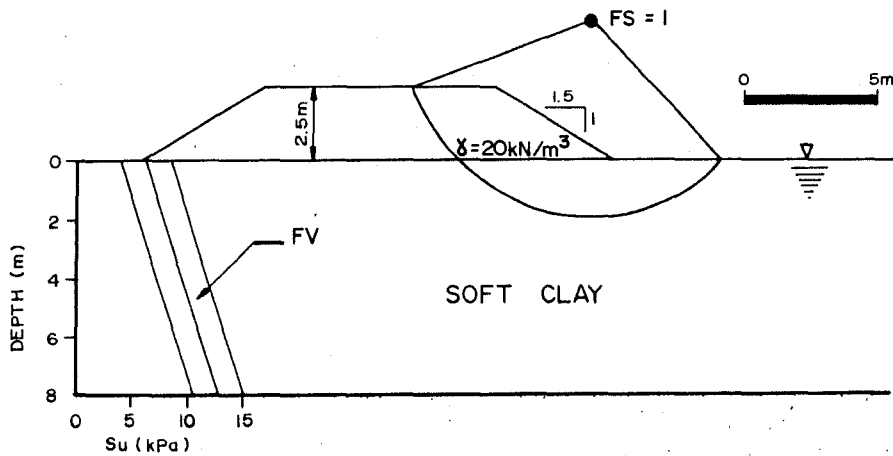


Figure 4 - Case 3 - Railway embankment failure near Sao Luis

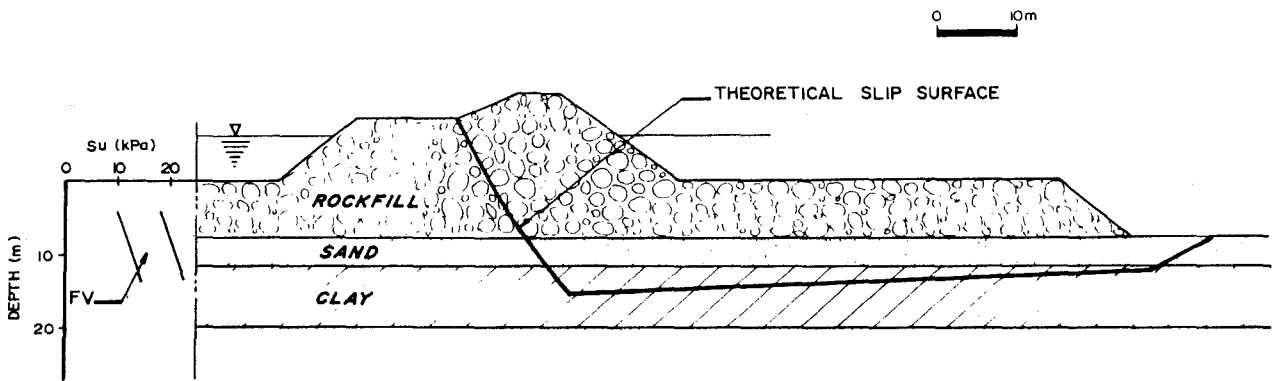


Figure 5 - Case 4 - Failure of a breakwater on soft soil

showed that site specific calibration data is very important.

Bjerrum's recommendations have recently been updated [1], but the new charts include considerable data scatter that makes the selection of a correction factor difficult.

When *FV* calibration data is not locally available, other forms of investigation, such as laboratory unconsolidated undrained triaxial tests, are recommended [4]. The results obtained should be compared with the *FV* strength. If there is a significant difference, corrections should be applied.

**References**

[1] Aas G., Lacasse S., Lunne T. & Hoeg

K. (1986) Use of in situ tests for foundation design. ASCE Specialty Conf. on In Situ Tests in Geotechnical Engineering, Blacksburg, Virginia Tech., Geotechnical Publication no. 6, pp 1-30.

[2] Bjerrum L. (1973) Embankments on soft ground, ASCE Specialty Conf. on Earth and Earth-supported Structures, Lafayette, Purdue University, vol. 2, pp 1-54.

[3] Coutinho R.Q. (1976) Medições da campo em um aterro experimental construído na área de barragem de Juturnaíba, DSc thesis, Federal University of Rio de Janeiro.

[4] Ortigao J.A.R. & Almeida M.S.S. (1988) Stability and deformation of

embankments on soft clay, Handbook of Civil Engineering Practice, Editors: P.N. Cheremisinoff, N.P. Cheremisinoff and S.L. Cheng, Technomics Publ., vol. 3, New Jersey, pp 267-336.

[5] Ortigao J.A.R. & Collet H.B. (1987) Errors due to soil-rod friction in field vane tests. ASTM Int. Symp. on Laboratory and Field Vane Shear Strength Testing, Tampa, ASTMSTP 1014, pp 104-116.

[6] Ortigao J.A.R. Werneck M.L.G. & Lacerda W.A. (1983) Embankment failure on clay near Rio de Janeiro, ASCE Journal of Geotechnical Engineering, vol. 107:2, pp 1460-1479.

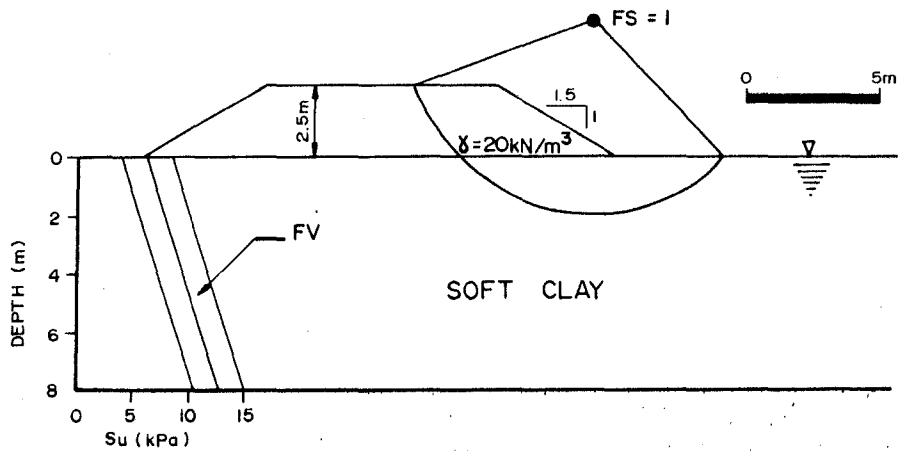


Figure 4 - Case 3 - Railway embankment failure near Sao Luis

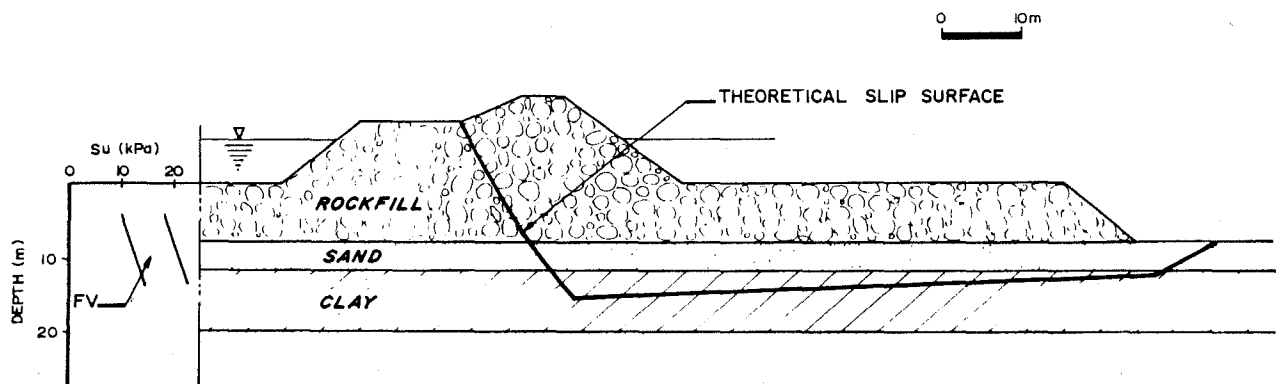


Figure 5 - Case 4 - Failure of a breakwater on soft soil

showed that site specific calibration data is very important.

Bjerrum's recommendations have recently been updated [1], but the new charts include considerable data scatter that makes the selection of a correction factor difficult.

When *FV* calibration data is not locally available, other forms of investigation, such as laboratory unconsolidated undrained triaxial tests, are recommended [4]. The results obtained should be compared with the *FV* strength. If there is a significant difference, corrections should be applied.

**References**

[1] Aas G., Lacasse S., Lunne T. & Hoeg

K. (1986) Use of in situ tests for foundation design. ASCE Specialty Conf. on In Situ Tests in Geotechnical Engineering, Blacksburg, Virginia Tech., Geotechnical Publication no. 6, pp 1-30.

[2] Bjerrum L. (1973) Embankments on soft ground, ASCE Specialty Conf. on Earth and Earth-supported Structures, Lafayette, Purdue University, vol. 2, pp 1-54.

[3] Coutinho R.Q. (1976) Medições da campo em um aterro experimental construído na área de barragem de Juturnaíba, DSc thesis, Federal University of Rio de Janeiro.

[4] Ortigao J.A.R. & Almeida M.S.S. (1988) Stability and deformation of

embankments on soft clay, Handbook of Civil Engineering Practice, Editors: P.N. Cheremisinoff, N.P. Cheremisinoff and S.L. Cheng, Technomic Publ., vol. 3, New Jersey, pp 267-336.

[5] Ortigao J.A.R. & Collet H.B. (1987) Errors due to soil-rod friction in field vane tests. ASTM Int. Symp. on Laboratory and Field Vane Shear Strength Testing, Tampa, ASTM STP 1014, pp 104-116.

[6] Ortigao J.A.R. Werneck M.L.G. & Lacerda W.A. (1983) Embankment failure on clay near Rio de Janeiro, ASCE Journal of Geotechnical Engineering, vol. 107:2, pp 1460-1479.